




Quick Point Live Centers, Sets and Replacement Points

- Accuracy guaranteed to $\pm .00025$.
- Interchangeable points reduce the need for several centers.
- Purchase individual replacement points or a complete set.
- Special points are available upon request.
- Mounting taper of points is 1:10.
- Safe storage container provided when you purchase a complete set.
- Point extractor for easy removal of points is included in the set or can be purchased separately.

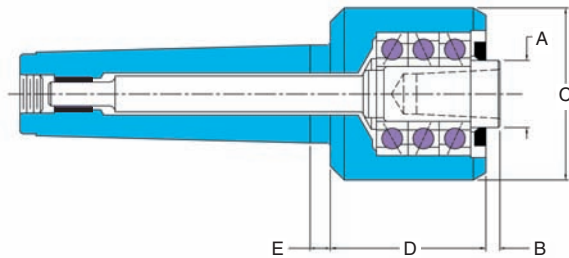

A Quick Point Set includes: one live center, one male point, one female point, one tracer point, one bull nose point, and one point extractor.


QUICK POINT SETS

Model	Taper
49502	2
49503	3
49504	4
49505	5




POINT EXTRACTORS


Model	Taper
49904	2, 3, 4
49905	5

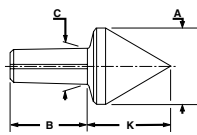


M - Male Point

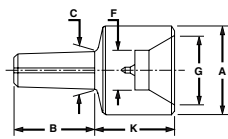

F - Female Point

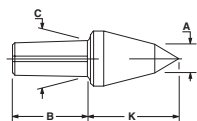

T - Tracer Point

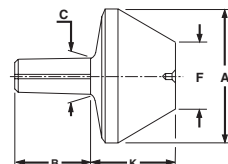

BN - Bull Nose Point

LIVE CENTER*

Model	MT	A	B	C	D	E	Max. RPM	W. P. Weight
49102	2	1	1/4	21/8	2	3/8	5000	100
49103	3	1	1/4	21/8	2	3/8	5000	350
49104	4	1 1/4	1/4	27/8	35/16	3/8	5500	550
49105	5	19/16	1/4	31/16	225/32	3/8	5500	1400

*Live Center includes male point unless otherwise specified.

QUICK POINTS

Model	MT	Style	A	F	G	K	C	B
91031	2/3	M	1	-	-	13/16	.474	61/64
91032	2/3	F	1 1/8	1/2	7/8	13/32	.474	61/64
91033	2/3	T	3/8	-	-	15/16	.474	61/64
91034	2/3	BN	13/4	7/8	-	13/16	.474	61/64
91041	4	M	1 1/8	-	-	15/16	.591	13/16
91042	4	F	13/8	5/8	11/8	17/32	.591	13/16
91043	4	T	1/2	-	-	113/16	.591	13/16
91044	4	BN	2 1/4	1	-	19/16	.591	13/16
91051	5	M	1 1/2	-	-	111/16	.867	125/64
91052	5	F	1 1/2	3/4	11/4	11/4	.867	125/64
91053	5	T	1/2	-	-	2	.867	125/64
91054	5	BN	2 3/4	1 1/2	-	15/8	.867	125/64